

# IMPORTANT RECALL NOTICE

Cannondale has become aware of a potentially serious problem with CODA brand 1" quill stems used on the following road bikes and sold aftermarket as CODA Competition 1" road stems. These stems were made in Taiwan by J.D. Some have expansion wedges with poorly manufactured, oversize female threads. These oversize threads result in a poor fit with the stem bolt and may strip when tightened. If the threads strip the stem can rotate in the steering tube. This could lead to loss of control with risk of injury or death.

## Cannondale bikes equipped with stems subject to recall:

1999 model year R5000/Saeco Replica  
1999 model year R4000  
1999 model year Multisport 4000  
1999 model year R2000  
1999 model year Multisport 2000  
1999 model year R1000  
1999 model year Multisport 800  
1999 model year R800 Compact  
1999 model year R800  
1999 model year R600  
1999 model year R500  
1999 model year R300 Compact  
1999 model year R300

1999 model year T1000  
1999 model year T700 (rigid only)  
1999 model year T500


1999 model year Cyclocross 800 (rigid only)

## Aftermarket CODA Competition 1" road stems:

QSRFL80/SLV 80mm (SLV = silver finish)  
QSRFL90/SLV 90mm  
QSRFL100/SLV 100mm  
QSRFL110/SLV 110mm  
QSRFL120/SLV 120mm  
QSRFL9090/SLV 90mm/90 degree  
QSRFL90110/SLV 110mm/90 degree  
QSRFL90120/SLV 120mm/90 degree  
QSRFL90/BBQ 90mm (BBQ = matte black finish)  
QSRFL100/BBQ 100mm  
QSRFL110/BBQ 110mm  
QSRFL120/BBQ 120mm

Please stop riding the bicycle and bring it to your authorized Cannondale retailer for a no charge stem expansion wedge swap. These new wedges are black and must be fitted to stems on any subject to recall bicycles.

Should you have any questions please call Customer Service at **1-800-BIKEUSA**.

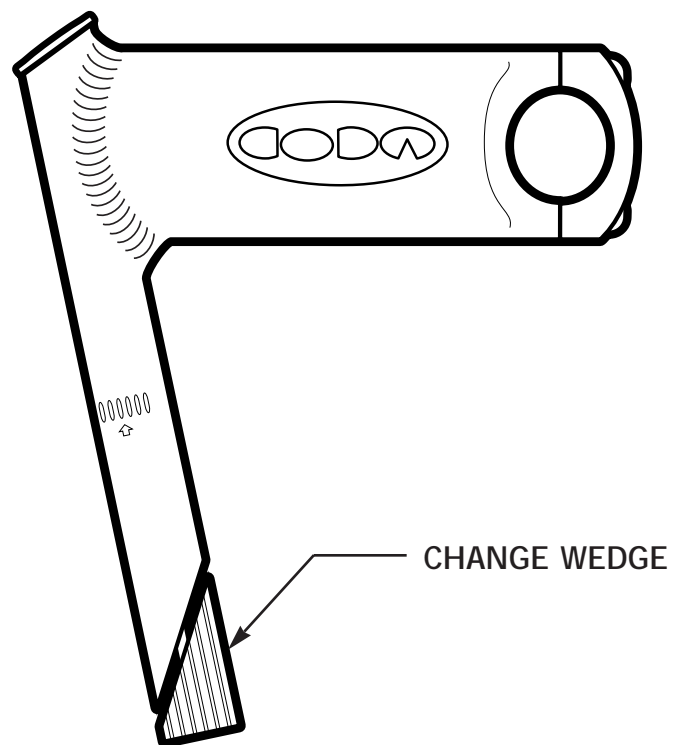

August 18, 1999

**cannondale**  
HANDMADE IN USA